

Failure	Cause	Possible remedies
Varying depths of penetration 	Incorrect piston position due to -damaged or missing piston ring -incomplete cocking movement -carbon build-up	change piston repeat correct cocking motion clean the tool (see operating instructions)
Cartridge does not eject 	- Driving power is too high - No fastener in tool	1) Bring piston forward by tapping tool on ground 2) Repeat cocking motion 3) If malfunctioning continues:disassemble tool according to operating instructions and push out cartridge with rod!
If driving power is too high always change to lighter cartridges! Generally start with lighter power loads!		
Damaged stopping/possibly no cocking possible 	- Driving power too high - No fastener in tool	Change Stopping and/or use lighter cartridge
DX E72 Cartridge Selection Guide		

23-01-2006

Item # 273111

Failure	Cause	Possible remedies
Varying depths of penetration 	Incorrect piston position due to -damaged or missing piston ring -incomplete cocking movement -carbon build-up	change piston repeat correct cocking motion clean the tool (see operating instructions)
Cartridge does not eject 	- Driving power is too high - No fastener in tool	1) Bring piston forward by tapping tool on ground 2) Repeat cocking movement 3) Malfunctioning continues:disassemble tool according to operating instructions Push out cartridge with rod
If driving power is too high always change to lighter cartridges! Generally start with lighter power loads!		
Damaged stopping/possibly no cocking possible 	- Driving power too high - No fastener in tool	Change Stopping and/or use lighter cartridge
DX E72 Cartridge Selection Guide		

23-01-2006

Item # 273111

Failure	Cause	Possible remedies
Varying depths of penetration 	Incorrect piston position due to -damaged or missing piston ring -incomplete cocking movement -carbon build-up	change piston repeat correct cocking motion clean the tool (see operating instructions)
Cartridge does not eject 	- Driving power is too high - No fastener in tool	1) Bring piston forward by tapping tool on ground 2) Repeat cocking movement 3) Malfunctioning continues:disassemble tool according to operating instructions Push out cartridge with rod
If driving power is too high always change to lighter cartridges! Generally start with lighter power loads!		
Damaged stopping/possibly no cocking possible 	- Driving power too high - No fastener in tool	Change Stopping and/or use lighter cartridge
DX E72 Cartridge Selection Guide		

23-01-2006

Item # 273111

Failure	Cause	Possible remedies
Varying depths of penetration 	Incorrect piston position due to -damaged or missing piston ring -incomplete cocking movement -carbon build-up	change piston repeat correct cocking motion clean the tool (see operating instructions)
Cartridge does not eject 	- Driving power is too high - No fastener in tool	1) Bring piston forward by tapping tool on ground 2) Repeat cocking motion 3) Malfunctioning continues:disassemble tool according to operating instructions Push out cartridge with rod
If driving power is too high always change to lighter cartridges! Generally start with lighter power loads!		
Damaged stopping/possibly no cocking possible 	- Driving power too high - No fastener in tool	Change Stopping and/or use lighter cartridge
DX E72 Cartridge Selection Guide		

23-01-2006

Item # 273111